Marvel-Schebler/Tillotson

Division Borg-Warner Corporation, 2195 South Elwin Road, Decatur, Illinois 62525



SERVICE BULLETIN



Feb. 1979

#A1-79

TO: All registered manual holders

SUBJECT: HA-6 Aircraft Carburetor Part No. A10-5206-1

COMPLIANCE: As soon as possible

CARBURETORS AFFECTED:

CZ-0 Serlal Numbers -1 100 Thru 496

·2.

Except for Numbers 399, 413, 419, 480, 481

To improve the sealing of the internal economizer channel, remove the economizer channel plug #80-150 and replace it with #80-364 brass plug.

Kit #666-821 contains all necessary parts to service two carburetors as this installation is on a Beechcraft Duchess. Complete instructions on reverse side.


Post compilance in log book.

This can be installed with the carburetor on the airplane.



Marvel-Schebler/Tillc_Jon Division

Borg-Warner Corporation 2195 South Elwin Road. Decatur, Illinois 62525

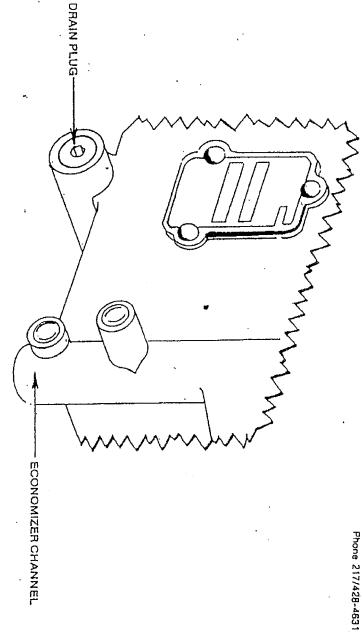

'n

INSTALL WITH RUBBER SIDE TOWARD CARBURETOR COAT CHAMFER AND-TWO THREADS WITH LOCTITE DURING ASSEMBLY 80-364 NEW BRASS ECONOMIZER PLUG REPLACES 80-150 16-A56 WASHER -- 80-150 PLUG 298-1 SEAL + 66-12 SAFETY WIRE

SPECIAL KIT #665-821

80-364 Plugs (brass) 16-A56 Washers 298-1 Lead Seals 66-12 Safety Wires PART NO.

242 Locitite

Instruction Sheet