



3220 100TH ST. SW BLDG E
EVERETT, WASHINGTON 98204
FAA-PMA FACILITY #PQ111NM

Service Bulletin Fuel Systems

Bulletin No.: MSA-7

Date: 10/11/94

SUBJECT: CARBURETOR NOZZLE REPLACEMENT

SECTION I - PLANNING INFORMATION

A. EFFECTIVITY:

All aircraft with Teledyne Continental Motors (TCM) O-200A engines having carburetor part number 10-4894 or 10-4115-1 installed.

B. REASON:

Precision Airmotive Corporation has received sporadic reports from operators who are experiencing engine richness, roughness, or hesitation after installing the one-piece venturi into their carburetors.

NOTE: If you have installed the one-piece venturi and are not experiencing any of these conditions you are not affected by this bulletin and no corrective action is required.

C. DESCRIPTION:

In some instances it appears that installation of the one-piece venturi increases the sensitivity of the main fuel nozzle and alters its fuel atomization characteristics. This condition results in engine roughness with an apparent rich mixture.

Extensive testing has shown that an improved main fuel nozzle which incorporates an atomizer type design will correct the symptoms described above. This nozzle is currently available from Precision Airmotive as part of a kit, P/N 666-942.

If you have experienced any of the above symptoms or have any questions regarding this bulletin please contact Precision Airmotive at 1-800-838-8181.

NOTE: Improper installation of the one-piece venturi can also result in the symptoms described above. It is very important to install the venturi using the proper tools and the procedure described in the overhaul manual. In addition, there are a number of other conditions that can result in a rich running carburetor, for example a leaking primer system, an improperly adjusted float, leaking bowl gasket, improper installation of the fuel nozzle, etc., so it's important to verify that the carburetor is assembled per the overhaul manual and that the rest of the fuel system is operating properly.

D. COMPLIANCE:

Recommended if symptoms exist as described in Section 1C of this bulletin

E. APPROVAL:

Technical aspects FAA approved.

F. MANPOWER:

No additional time if accomplished during carburetor overhaul, approximately .5 hours if accomplished after carburetor is removed from engine.

G. MATERIAL AVAILABILITY:

The following conversion kit is available from all parts distributors who carry genuine Precision Airmotive Parts.

666-942 Kit, Nozzle Conversion

The 666-942 Kit consists of the following parts:

47-850	Nozzle Assembly
16-222	Gasket, Nozzle
16-A107	Gasket, Power Jet
16-B75	Gasket, Body
78-A110	Washer, Body Screws (4 ea.)
82-11	Cotter Pin, (Float Pin)

To perform the conversion during **overhaul**, the nozzle assembly is available by itself, or as a component of the 286-2025 major overhaul kit.

H. TOOLING:

Not affected.

I. REFERENCES:

Aircraft Carburetors & Parts Manual, Form #MSAFSM dated March 30, 1993.

J. WEIGHT AND BALANCE:

Not affected.

K. PUBLICATIONS AFFECTED:

None.

SECTION II - ACCOMPLISHMENT INSTRUCTIONS

- A. Remove carburetor from aircraft.
- B. Follow the procedures in the Aircraft Carburetor Service Manual to disassemble the carburetor as required to access the main fuel nozzle.
- C. Replace the main fuel nozzle, reassemble carburetor, and torque per manual instructions.

SECTION II - ACCOMPLISHMENT INSTRUCTIONS (cont)

- D. After modification has been accomplished, stamp the carburetor nameplate as follows:
10-4894: Add "-1" after the part number (i.e. 10-4894 will become 10-4894-1)
10-4115-1: Overstamp "-1" with "-2" on the part number (i.e. 10-4115-1 will become 10-4115-2)
- E. Install, adjust and verify proper operation of the carburetor in accordance with the applicable engine/airframe maintenance and operation manual(s).
- F. Make an appropriate log book entry indicating conversion of the carburetor.

SECTION III - WARRANTY INFORMATION

- A. Operators who have installed a Precision Airmotive one piece venturi in their carburetor and have experienced the symptoms described in Section I, may be eligible for a no-charge warranty 666-942 kit. Those seeking warranty consideration will be required to call the Precision Airmotive toll-free Venturi Hotline at (800) 838-8181 or (206) 353-8181 for further information. If warranty is approved, a no-charge kit will be shipped to you. (Note: In order to receive warranty, you must be able to provide documented proof that a genuine Precision Airmotive venturi was installed in the carburetor).